


32311096

Issue A

Datasheet

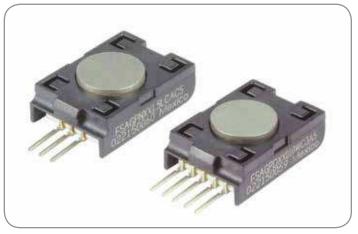

DESCRIPTION

The FSA Series are piezoresistive-based force sensors offering a ratiometric analog or digital output for reading force over the specified full scale force span and temperature range. They are fully calibrated and temperature compensated for sensor offset, sensitivity, temperature effects, and nonlinearity using an on-board Application Specific Integrated Circuit (ASIC). Direct mechanical coupling allows for easy interface with the sensor, coupling with tubing, membrane or a plunger, providing repeatable performance and a reliable mechanical interface to the application. The package also provides excellent corrosion resistance and isolation to external package stress. All products are designed and manufactured according to ISO 9001 standards.

VALUE TO CUSTOMERS

The FSA Series are designed to meet the customers' need for a compensated, amplified force sensor that provides analog and digital outputs, a variety of force sensing ranges, and enhanced durability and accuracy. Their flexible design provides multiple standard configurations over a wide operating temperature range.

DIFFERENTIATION

- Multiple force ranges allow the customer to choose the force range to maximize sensitivity and improve system resolution/ performance
- Overforce provides enhanced durability in applications where overforce may exist
- Enhanced accuracy includes all errors due to force nonlinearity, force hysteresis, and non-repeatability
- Total Error Band enhances system performance
- Digital output enhances performance through reduced conversion requirements and the convenience of direct interface to microprocessors
- Diagnostics functions allow the user to determine if the sensor is working correctly by detecting if the electrical paths are broken or shorted inside the sensor
- Supply voltage provides customers flexibility of design within the application

FEATURES

- · Wide variety of force ranges
 - Newton (N): 2, 5, 7.5, 10, 15, 20, 25
 - pound (lb): 1, 1.5, 2, 3, 5gram (g): 200, 500, 750
 - kilogram (kg): 1, 2
- Total Error Band: ±5 %FSS
- Accuracy: ±3 %FSS
- Ratiometric analog or SPI- or I²C-compatible digital output
- Fully calibrated and temperature compensated over a temperature range of 5 °C to 50 °C [41 °F to 122 °F]
- Overforce: 6804 g [15 lb]
- Supply voltage: 3.3 Vdc typ. or 5.0 Vdc typ.
- Low power consumption: 13 mW (analog) or 20 mW (digital)
- · Excellent part-to-part repeatability
- · Enhanced reliability
- Stable interface plunger
- · Internal diagnostic functions available
- REACH and RoHS compliant

POTENTIAL APPLICATIONS

Medical

- Ambulatory non-invasive pump pressure
- Infusion pumps
- Kidney dialysis machines
- · Occlusion detection

Industrial

- · Load and compression sensing
- Variable tension control

PORTFOLIO

The FSA Series joins the FSG Series, FSS Series, FSS-SMT Series, TBF Series, and 1865 Series.

Table 1. Operating Specifications

Characteristic	Analog			Digital			Unit
	Min.	Тур.	Max.	Min.	Тур.	Max.	
Supply voltage (V _{supply}): ^{1, 2, 3} 3.3 Vdc 5.0 Vdc	3.0 4.75	3.3 5.0	3.6 5.25	3.0 4.75	3.3 5.0	3.6 5.25	Vdc
Supply current: 3.3 Vdc 5.0 Vdc	_ _	2.0 2.6	_ _	_ _	2.8 3.9	3.9 4.6	mA
Power input		13			20		mW
Operating temperature range ⁴	0 [32]	_	70 [158]	0 [32]	_	70 [158]	°C [°F]
Compensated temperature range ⁵	5 [41]	_	50 [122]	5 [41	_	50 [122]	°C [°F]
Storage temperature range	-40 [-40]	_	85 [185]	-40 [-40]	_	85 [185]	°C [°F]
Startup time (power up to data ready)	_	_	5	_	_	3	ms
Response time	_	1	_	_	0.42	0.84	ms
Clipping limit: upper lower	_ 2.5	_ _	97.5 —	_ _	_ _	_ _	%V _{supply}
SPI/I ² C voltage level: low high	_ _	_ _	_ _	_ 80	_ _	20 —	%V _{supply}
Pull up on SDA/MISO, SCL/SCLK, SS	_	_	_	1	_	_	kOhm
Accuracy ⁶	_	_	±3	-	_	±3	%FSS ⁷ BFSL
Total Error Band ⁸	_	_	±5	_	_	±5	%FSS
Output resolution	_	_	_	12	_	_	bits
Long term stability ⁹	_	_	±0.50	_	_	±0.50	%FSS

¹Sensors are either 3.3 Vdc or 5.0 Vdc based on the catalog listing selected.

²Ratiometricity of the sensor (the ability of the device output to scale to the supply voltage) is achieved within the specified operating voltage.

³The sensor is not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.

⁴Operating temperature range: The temperature range over which the sensor will produce an output proportional to force.

⁵Compensated temperature range: The temperature range over which the sensor will produce an output proportional to force within the specified performance limits.

⁶Accuracy: The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the force range at 25 °C [77 °F]. Includes all errors due to force non-linearity, force hysteresis, and non-repeatability.

Full Scale Span (FSS): The algebraic difference between the output voltage at full scale force and the output at zero force.

⁸Total Error Band (TEB): Combined error from calibration, accuracy and temperature effects over the compensated temperature range at 5.0 V from 15% to 95% FSS.

⁹Long-term stability after 1000 hr of operation at 25 °C [77 °F].

Table 2. Environmental Specifications

Characteristic	Parameter		
Humidity	0% to 95% RH, non-condensing		
Vibration	MIL-STD-202, Method 214, Condition 1E (16.9 G)		
Shock	MIL-STD-202, Method 213, Condition F (1500 G)		
Life ¹	1 million full scale force cycles minimum		

¹Life may vary depending on specific application in which the sensor is utilized.

Table 3. Materials¹

Component	Material	
Covers	high temperature polyamide	
Plunger	stainless steel 316	
Substrate	alumina, ceramic	
Adhesives	epoxy, silicone	
Electronic components	ceramic silicon, glass, solder	


¹Contact Honeywell customer service for detailed material information.

Table 4. Absolute Maximum Specifications

Characteristic	Min.	Max.	Unit		
Supply voltage	-0.3	6.0	Vdc		
Voltage on any pin	-0.3	V _{supply} + 0.3	V		
Digital interface clock frequency: SPI I ² C	50 100	800 400	kHz		
ESD susceptibility (human body model)	2	_	kV		
Storage temperature range	-40 [-40]	85 [185]	°C [°F]		
Overforce limit	_	6804 [15]	g [lb]		
Minimum operating voltage	2.8 Vdc				
Lead soldering time and temperature	4 s max. at 220 °C [428 °F]				

Figure 1. Nomenclature and Order Guide

For example, **FSAGPNXX002WCAA3** defines an FSA Series Force Sensor, gel coupling, plunger contact element, no diagnostics, 2 N force range, force unit in Newtons, compression force type, analog output, 10% to 90% transfer function, 3.3. Vdc supply voltage

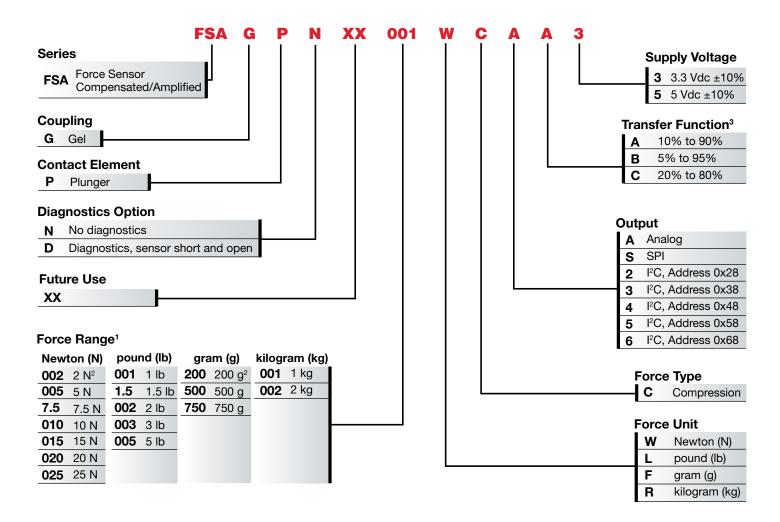

¹Custom designations available upon request.

COMMON CATALOG LISTINGS


FSAGPDXX010WCAA5 FSAGPDXX001RCAB5 FSAGPNXX1.5LCAC5 FSAGPNXX003LCAC5 FSAGPNXX001RC4C3 FSAGPDXX005LCSB5 FSAGPDXX200FC5B3 FSAGPDXX200FC5B3 FSAGPDXX1.5LC5B5

²Consult with factory.

³For other available transfer functions, contact Honeywell customer service.


Figure 2. Transfer Function Limits¹

Analog Version

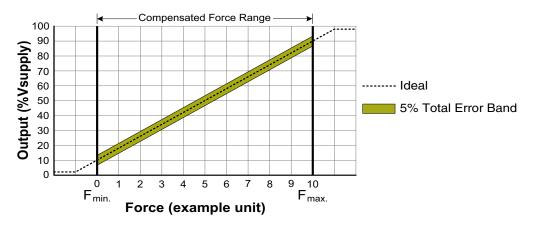

Output (V) =
$$\frac{0.8 \text{ x Vsupply}}{\text{Force}_{\text{range}}} x \text{ (Force}_{\text{applied}}) + 0.10 \text{ x Vsupply}$$

Digital Version

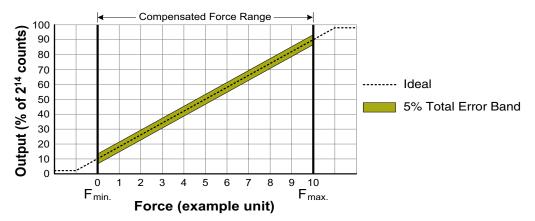


Output (% of 2¹⁴ counts) =
$$\frac{80\%}{\text{Force}_{\text{range}}} x \text{ (Force}_{\text{applied}}) + 10\%$$

¹Transfer Function "A" is shown. See Figure 1 for other available transfer function options.


Figure 3. Mounting Dimensions (For reference only: mm/in.)

Analog version

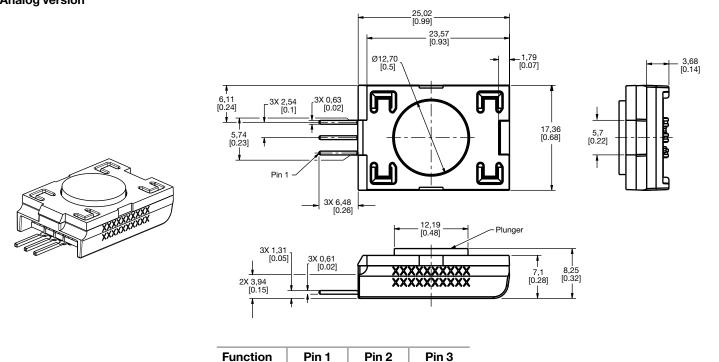

Vout

GND

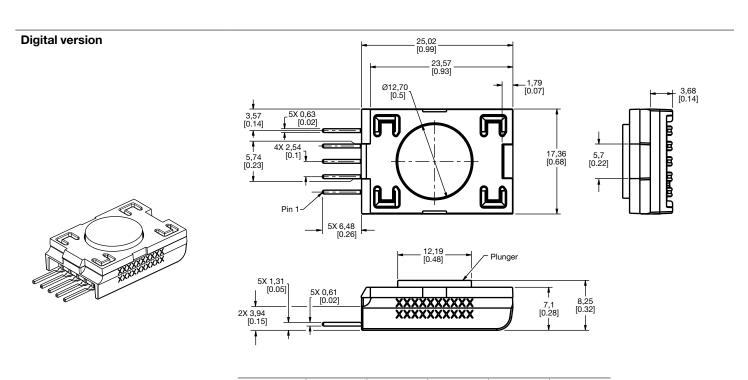

Vsupply

analog

ADDITIONAL INFORMATION

The following associated literature is available on the Honeywell web site at sensing.honeywell.com:

- · Product Range Guide
- · Product Line Guide
- Product Installation Instructions
- Technical Information:
 - SPI Communications with Honeywell Digital Output Force Sensors
 - I²C Communications with Honeywell Digital Output Force Sensors

Find out more

Honeywell serves its customers through a worldwide network of sales offices, representatives and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office.

To learn more about Honeywell Sensing and Productivity Solutions' products, call +1-815-235-6847 or 1-800-537-6945, visit sensing.honeywell.com, or e-mail inquiries to info.sc@honeywell.com

Sensing and Productivity Solutions Honeywell 1985 Douglas Drive North Golden Valley, MN 55422 honeywell.com

▲ WARNING PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

▲ WARNING MISUSE OF DOCUMENTATION

- The information presented in this datasheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

Warranty/Remedy

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective.

The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

